

county_bridge_num	road_number	road_name	milepost	bentspan	elementname	maintrecommmendation	comments	FC	Comments
00736A	107573	B St	0.565	P3, B5	Pile			RA	
00736A	107573	B St	0.565	P5, B6	Pile			RA	
00736A	107573	B St	0.565	B 2 P6	Pile	Fill in hole around Bent 2 Pile 6 unless there is a specific reason why it is there.		RA	
00736A	107573	B St	0.565		Drains	Clean clogged drains.		RA	
00736A	107573	B St	0.565		Rail	Clean and paint the rail. Remove all unsound concrete and repair post.		RA	
1202	197800	Nicol Rd	0	B1	Pile	Pile 4, Bent1		UL	Critical Findings
1202	197800	Nicol Rd	0		Girder	G7		UL	
1206	011300	086th Av	0.195	B1, P4	Pile			UL	Critical Findings
1206	011300	086th Av	0.195	B 3	Cap	Replace cap at bent 3 due to decay and loss of bearing.		UL	
1206	011300	086th Av	0.195		Cap	Remove vegetation debris and trees from the channel. Cut back undercut tree on downstream side to protect gas		UL	
1219	175500	Labrousse Rd	0.353		Rail	Replace split rail posts.		RL	
1219	175500	Labrousse Rd	0.353		Abutments	Hydraulic engineer to review scour code.		RL	
1219	175500	Labrousse Rd	0.353	All	Approach	Seal cracks in pavement		RL	
1219	175500	Labrousse Rd	0.353		Channel	Remove dam downstream		RL	
1219	175500	Labrousse Rd	0.353		Backwall	Repair backwall undermining.		RL	
1232	193000	Minter Bridge Rd	0.247	B5, P4	Pile			RL	
1237	069000	229th Av	0.797		Deck	Pave bridge full width and repair crack in AC wearing surface.		UC	
1237	069000	229th Av	0.797		Misc.	Review load rating for AC depth		UC	
1237	069000	229th Av	0.797		Structure	Verify that load rating has been updated for new caps.		UC	
1237	069000	229th Av	0.797		Stringer	Monitor checked stringers 3-14 indicated in the Timber Boring Report.		UC	
1239	055700	192nd Av	0.837	B 2	Cap			NR	Critical Findings
1239	055700	192nd Av	0.837	B 3	Cap			NR	Critical Findings
1239	055700	192nd Av	0.837		Pile	Shim pile w/ loss of bearing and provide positive connection to cap.		NR	
1239	055700	192nd Av	0.837		Channel	Realign channel		NR	
1239	055700	192nd Av	0.837		Rail	Repair severly checked and split posts.		NR	
1239	055700	192nd Av	0.837	All	Pavement	Seal cracks in the pavement		NR	
1243	153500	Gaston Rd	0.512	B2	Cap			RC	Critical Findings
1265	194360	Mount Richmond Rd	0.369	B3 P1	Pile			RL	Critical Findings
1265	194360	Mount Richmond Rd	0.369	B3	Cap			RL	Critical Findings
1265	194360	Mount Richmond Rd	0.369	B4 P2	Pile			RL	Critical Findings
1265	194360	Mount Richmond Rd	0.369		Channel	Remove vegetation from channel		RL	
1269	201850	Old Hwy 47	0.458	P 4-4	Pile			RL	
1269	201850	Old Hwy 47	0.458	P 4-3	Pile			RL	
1269	201850	Old Hwy 47	0.458		Deck	Repave south approach.		RL	
1269	201850	Old Hwy 47	0.458		Rail	Replace checked posts.		RL	
1269	201850	Old Hwy 47	0.458	B 3	Pile	Place riprap around the piles		RL	
1269	201850	Old Hwy 47	0.458		Deck	Resurface. Overlay.		RL	

1362	239300	Uebel Rd	0.046 B2	Rail	Replace split cushion block at B2 left.		RL
1362	239300	Uebel Rd	0.046 B5	Pile	P4, B5		RL
1362	239300	Uebel Rd	0.046 S 1	Girder	Replace Girder 17 Span 1		RL
1362	239300	Uebel Rd	0.046 All	Guard Rail	The approach rail terminators have no anchors.		RL
1362	239300	Uebel Rd	0.046	Embankment	Remove the rock dam from the upstream side of the bridge to stop erosion of the east and west banks.		RL
1371	149200	Fern Flat Rd	1.967 B1	Cap	Replace Bent 1 cap.		RL Critical Findings
1371	149200	Fern Flat Rd	1.967 B 1	Abutments	Place scour protection at Bent 1		RL
1371	149200	Fern Flat Rd	1.967	Backwall	Replace rotted backwalls.		RL
1371	149200	Fern Flat Rd	1.967 All	Pile	Clean and paint steel piles		RL
1371	149200	Fern Flat Rd	1.967 All	Approach	Regrade approaches		RL
1374	239200	Turk Rd	0.04 B 3	Pile	Replace P4-3		RL Critical Findings
1374	239200	Turk Rd	0.04 All	Timber Walls	Remove the timber walls and install bank protection.		RL
1374	239200	Turk Rd	0.04 All	Girder	Replace Stringer 14, Span 2.		RL
1374	239200	Turk Rd	0.04 Bent 2	Cap			RL
1374	239200	Turk Rd	0.04 B 4	Cap			RL
1374	239200	Turk Rd	0.04 B1	Backwall			RL
1374	239200	Turk Rd	0.04 B 5	Deck	Replace rotted deck plank at Bent 5 and patch overlay		RL
1374	239200	Turk Rd	0.04	All	Review load rating.		RL
1374	239200	Turk Rd	0.04	Unknown	ODOT review NBI 113 rating (Scour critical bridge)		RL
1374	239200	Turk Rd	0.04 All	Channel	Monitor the scour at bridge.		RL
1379	209700	Pongratz Rd	2.12 B1	Cap	Replace decayed cap at bent1.	Changed to Urgent by AC.	RL
1379	209700	Pongratz Rd	2.12 All	Channel	Monitor for rot	Channel erosion	RL
1402	247550	West Shore Dr	3.369	Abutments	Investigate slope conditions further; analyze potential failures and place protective measures.		RC
1402	247550	West Shore Dr	3.369	Cap	Clean nests and debris from Bent Caps 2 & 3		RC
1402	247550	West Shore Dr	3.369 All	Rail	Install missing bolts		RC
1402	247550	West Shore Dr	3.369	Approach	Repair approach roadway settlement.		RC
1403	201870	Old Hwy 47	1.93 All	Girder	Clean and paint top flange of steel girders		RL
1405	201870	Old Hwy 47	0.245 B1	Cap			RL Critical Findings
1405	201870	Old Hwy 47	0.245	Structure	Post bridge for SU6 and SU7 trucks based on 10/17/2016 load rating results.		RL
1405	201870	Old Hwy 47	0.245 B2	Abutments	Install Scour countermeasures at B2.		RL
1405	201870	Old Hwy 47	0.245 B3	Abutments	Install Scour countermeasures at B3.		RL
1405	201870	Old Hwy 47	0.245 B 1	Pile	Repair or replace Columns 2-1		RL
1405	201870	Old Hwy 47	0.245	Girder	Remove drift and debris.		RL
1405	201870	Old Hwy 47	0.245 B 2	Pile	Repair or replace Columns 2-2		RL
1405	201870	Old Hwy 47	0.245 B 3	Pile	Repair or replace Columns 2-3		RL
1405	201870	Old Hwy 47	0.245 S 3, G 1	Girder	Monitor checking in Span 1 & 3, Girder 1.		RL
1406	201870	Old Hwy 47	0.15 B5	Pile	P4		RL
1406	201870	Old Hwy 47	0.15 B1	Pile	P3		RL
1406	201870	Old Hwy 47	0.15 B 5	Pile	Replace P 2	2" of rot	RL
1406	201870	Old Hwy 47	0.15	Misc.	Remove all loose concrete and patches. Clean wire brush and paint all exposed steel.		RL
1406	201870	Old Hwy 47	0.15 B 4	Pile	Replace P 3	5" of rot	RL
1406	201870	Old Hwy 47	0.15 B 3	Pile	Replace P 5	4" of rot	RL

1406	201870	Old Hwy 47	0.15 B 2	Pile	Replace P 5			
1406	201870	Old Hwy 47	0.15 B 3	Pile	Replace P 4	4" of rot		RL
1406	201870	Old Hwy 47	0.15 ALL	Deck	PATCH SPALLS	7" of rot		RL
1406	201870	Old Hwy 47	0.15 B 5	Pile	Replace P 1	4" of rot		RL
1407	201870	Old Hwy 47	0.045	Rail	Timber pedestrian rail needs additional horizontal boards to meet sphere requirement.			
1407	201870	Old Hwy 47	0.045	Rail	Add additional connections to tighten system railing. Add missing nuts on back of through bolts on left posts.			RL
1407	201870	Old Hwy 47	0.045	Misc.	Patch the honeycomb void in Span 2 left overhang and the spall in Span 1 left overhang at first post.			RL
1407	201870	Old Hwy 47	0.045 B1	Sidewalk	Fill erosion hole at Bent 1 sidewalk approach.			RL
1407	201870	Old Hwy 47	0.045	Channel	Place rock protection to prevent fill loss and erosion.			RL
1407	201870	Old Hwy 47	0.045 All	Misc.	Patch the honeycomb void Girder 2-3.			RL
1407	201870	Old Hwy 47	0.045	Sidewalk	Monitor sidewalk non-positive compression wedge connection system for tightness.			RL
1407	201870	Old Hwy 47	0.045	Girder	Monitor hairline cracking in girders.			RL
1407	201870	Old Hwy 47	0.045	Channel	Monitor channel scour.			RL
1417C	241700	Vernonia Rd	1.38	Culvert	Add scour countermeasures at both ends of culvert.			
1417C	241700	Vernonia Rd	1.38	All	Perform load rating			RC
1417C	241700	Vernonia Rd	1.38	Culvert	Clean and patch spalls and paint exposed rebar.			RC
1417C	241700	Vernonia Rd	1.38	Culvert	Monitor cracks in culvert.			RC